


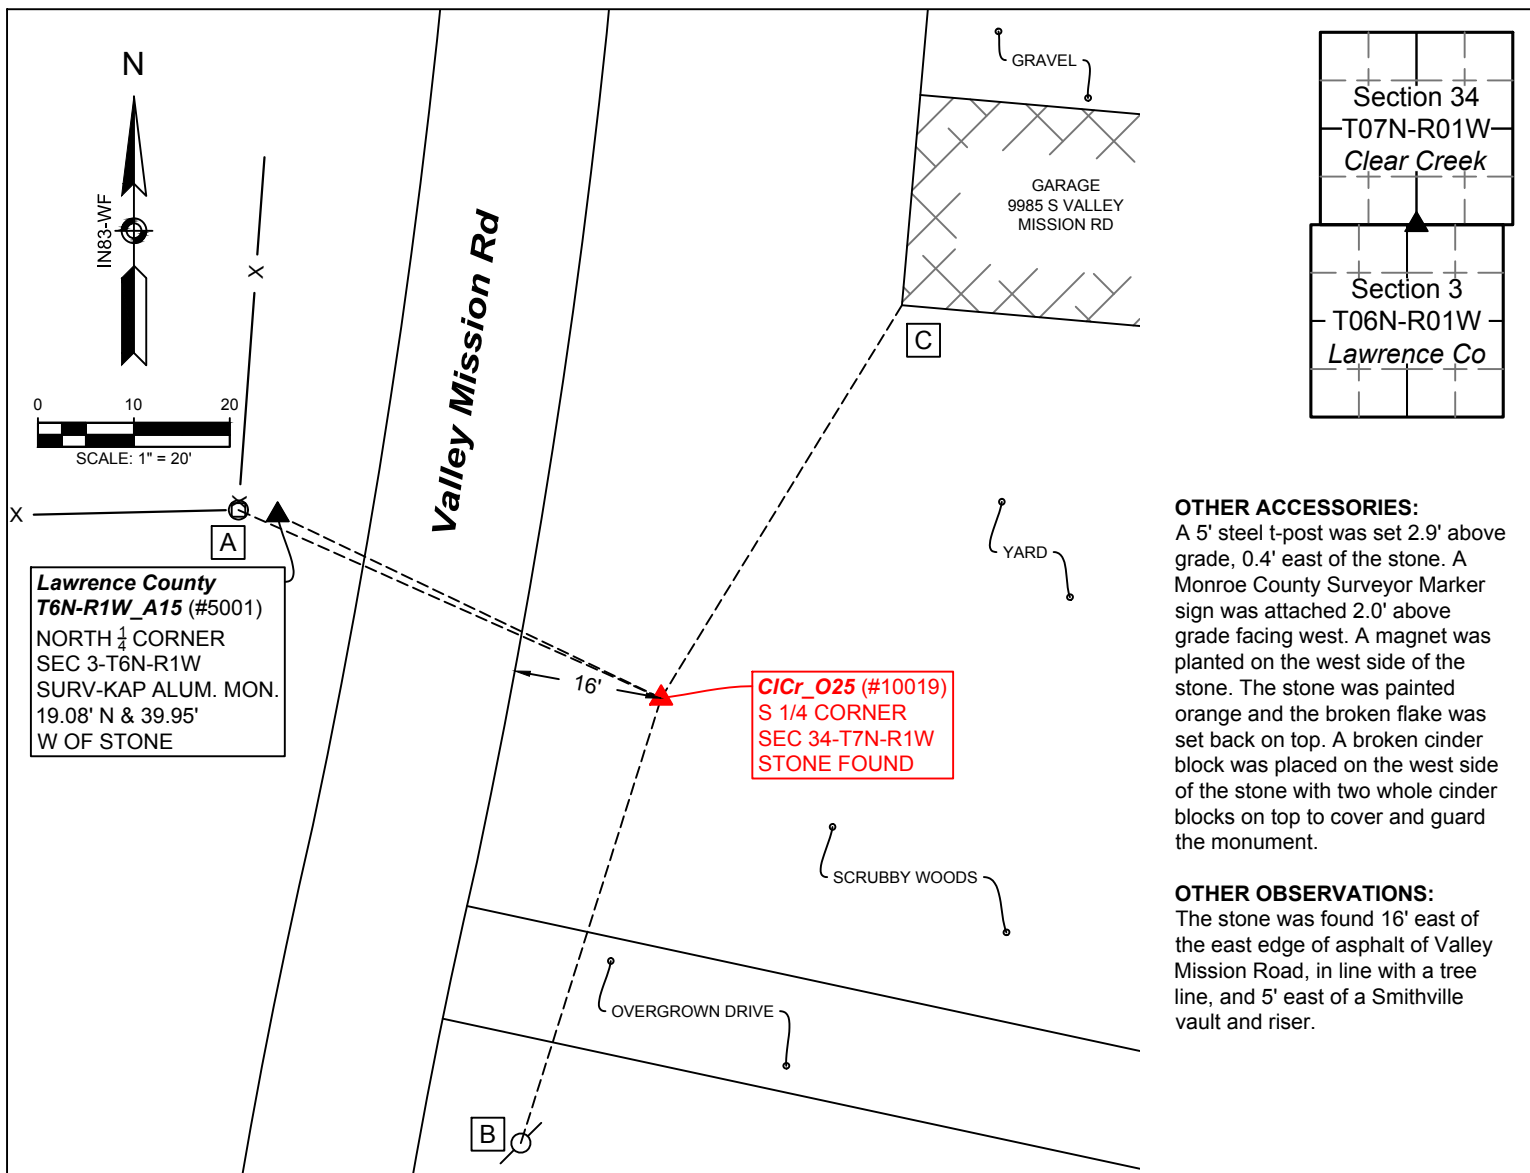

OTHER ACCESSORIES:
A 5' steel t-post was set 2.9' above grade, 0.4' east of the stone. A Monroe County Surveyor Marker sign was attached 2.0' above grade facing west. A magnet was planted on the west side of the stone. The stone was painted orange and the broken flake was set back on top. A broken cinder block was placed on the west side of the stone with two whole cinder blocks on top to cover and guard the monument.

OTHER OBSERVATIONS:
The stone was found 16' east of the east edge of asphalt of Valley Mission Road, in line with a tree line, and 5' east of a Smithville vault and riser.

WITNESS MONUMENT TIES:

- MAG nail and shiner set 0.7' above grade in the south side of a 9" treated round fence post corner;
N 66° W 48.2'
- MAG nail and shiner set 1.0' above grade in the west side of a 8" utility pole with riser;
S 17° 30' W 48.6'
- Southwest corner of garage (block foundation);
N 31° 30' E 48.0'

MONUMENT ACCESSORIES:

(#5001) 3-1/2" diameter aluminum survey cap stamped "Lawrence County Surveyor LS#S0242 Survey Marker Do Not Disturb North 1/4 Corner Section 3 T6N R1W" found 0.1' below grade per Lawrence County Section Corner Data Sheet - Corner Reference A15; N64° 28' 01" W 44.27'

NOTES:

- Field work was performed on November 6, 2017.
- Monroe County Surveyor's Field Book 51, page 5.
- Project Name: ClearCreek2017, Field work by: RSO, Drawn by: RSO, Reviewed by: RSO & TER.
- This document is not complete without the associated plat and report of survey for Section 34-T07N-R01W by Rachel Oser, of the Monroe County Surveyor's Office, dated May 29, 2018 and recorded as Instrument Number 2018006787 in the Monroe County Recorder's Office.
- Coordinates, bearings and distances shown hereon were obtained from GPS observations utilizing the Indiana Real-Time Network (INCORS). Indiana West Zone, NAD83(2011) Epoch 2010.0000, State Plane Grid Coordinates, US Survey Feet. Geoid model G2012BU7. Datum NAD83_NO_TRANS.
- Basis of bearings is Indiana State Plane Coordinates West Zone
- Photos were taken with an iPhone 6S on November 6, 2017

▲ **Monument Description:** A 0.3' x 0.6' limestone with cut "+" was found 0.4' below grade. The east portion of the cut "+" is not attached to the top of the stone.
State Plane Grid Coordinates: Northing: 1363977.5', Easting: 3116289.1'

SHEET 1 OF 3	MONUMENT RECORD CORNER ID: CICr_O25	Quarter Corner Section 34 - T07N-R01W Clear Creek Township Monroe County, Indiana	 OFFICE OF THE MONROE COUNTY SURVEYOR Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	---	---	--



looking east at ClCr_O25




looking east at ClCr_O25



looking east
at ClCr_O25



looking north
at ClCr_O25

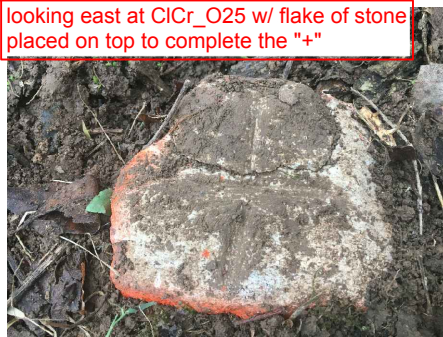

looking east at ClCr_O25 w/ flake of stone
placed on top to complete the "+"



looking east
ClCr_O25
is under blocks



2017 ORTHOPHOTO
(SCALE 1" = 100')

Lawrence County
T6N-R1W_A15 (#5001)
NORTH $\frac{1}{4}$ CORNER
SEC 3-T6N-R1W
SURV-KAP ALUM. MON.
19.08' N & 39.95'
W OF STONE

Valley Mission Rd

ClCr_O25 (#10019)
S $\frac{1}{4}$ CORNER
SEC 34-T7N-R1W
STONE FOUND

SHEET
2
OF
3

MONUMENT RECORD
CORNER ID:
ClCr_O25

Quarter Corner
Section 34 - T07N-R01W
Clear Creek Township
Monroe County, Indiana



MONROE COUNTY SURVEYOR'S OFFICE
Trohn Enright-Randolph Monroe County Surveyor
Rachel Savich Oser Professional Surveyor
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

ORIGINAL GOVERNMENT SURVEY:

Year Surveyed: 1811 By: Arthur Henrie

MCS Page: 199

Original monument: Wooden Post

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Dist.(lks)	Dist. (ft)
Beech	18"	S65°E	8 lks	5.3'
Beech	12"	N83°W	20 lks	13.2'

Notes: Calc. o/s to Lawrence County closing corner is 61.7' (o/s corner was not originally set)

SUBSEQUENT CORNER RESTORATION:

Date Surveyed: 11/23/1871 By: Alexander Spencer, MCSO

Where filed or recorded: MCS-LSB2-PG182

Monument: S 1/2 Mile post, found or set not indicated, new BTs made

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Dist.(lks)	Dist. (ft)
Beech	20"	S19°W	39 lks	25.7'
Beech	20"	N20°W	37 lks	24.4'

OTHER HISTORICAL SURVEY INFORMATION: In 1994, Phil Tapp noted that he accepted a fence post as the South 1/4 corner of Section 34 (Survey ID 38 - Instrument Number 405948). The recorded survey drawing does not depict the fence post or provide dimensions to it, but BRCJ provided a digital file of the 1994 survey and we were able to verify that the fence post accepted by Mr. Tapp is approximately 119' east of the found stone. After finding the stones at the North 1/4 corner, Center-South 1/16 corner, and East 1/16 corner of Section 34 and a monument at the Lawrence County closing corner, we were fairly certain that the fence post was not the corner, as it would have resulted in a significant skew. The Tapp survey does not appear to have used the post to establish anything else.

OTHER EVIDENCE**ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND:**

Date of Search: 11/06/2017 By: Rachel Savich Oser

Monument Found: 0.3'x0.6' limestone with cut "+"

BTs or Reference Objects Found: None

Notes:


SUPPORTING EVIDENCE: Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, mow lines, plantings, etc. Site source of any testimony. I talked to Chris Riggs in February of 2001 when I was locating the Lawrence County closing corner to the west. His dad, Earl Riggs, built the house north of the found stone. Earl Riggs is deceased, but his property is still in the family. The Riggs family owns the SW1/4 of the SE1/4 of Section 34 and all that part of the SE1/4 of the SW1/4 of Section 34 lying east of Valley Mission Road. Chris told me that he thought the corner used to be over by the fiber optic vault, which is within 5' of the found stone. The remains of east/west fence were found about 11' north of the south line of the SE1/4 of Section 34. The Riggs mow line is just a foot or two north of the found stone.

VICINITY DESCRIPTION: Describe corner location relative to nearby features and how to reach the corner location - note fences, roads, timber, streams, topo changes, etc. The corner is 16' east of the east edge of asphalt of Valley Mission Road and 5' east of a Smithville vault and riser. The corner is on the edge of a mowed lawn to the north and a scrubby woods to the south.

SEARCH PROCEDURE: Describe search procedure and give an estimate of man hours spent searching. Include description of how search area was located (pacing, stakeout, maps, photos, old ties, etc.) Do you think additional search might recover evidence?

I calculated a location to look for the monument based on the measured distance between the found stones at C1Cr_O24 and C1Cr_P24 and I decided on a search radius of 14.9' around the calculated point. I cleared brush and raked the search area but I didn't find anything. Then I began probing at approximately 3" intervals, working my way west from the calculated point. I worked my way west instead of east because there are some north/south fence remains on the west side of the Riggs garage, and it seemed like the monument might line up with them. I looked for over 2 hours (hitting very little rock) before I found the stone 0.4' below grade and firmly planted. The stone was missing a flake off the east side of the top, which I suspect was damage that I caused while digging it up. The stone had a clear cut "+" to the north, west, and south, but the portion of the "+" to the east was in the flaked off area. I tested the stone with hydrochloric acid to confirm the presence of carbonate minerals. I washed the stone, but I did not find any additional markings. When I reburied the stone I found the missing flake. And as I suspected, it completed the missing portion of the "+".

There is a Lawrence County Surveyor aluminum surv-kap 19.08' north and 39.95' west of the stone. The Lawrence County Surveyor, Corey Allen, and the former Lawrence County Surveyor, Mike Arena, both agreed that the stone we found at this corner was better evidence of the section line than the evidence that Mr. Arena used to establish the Lawrence County marker. Corey Allen intends to set a new offset monument for the Lawrence County line, preserving the surv-kap as a reference and a possible property corner.

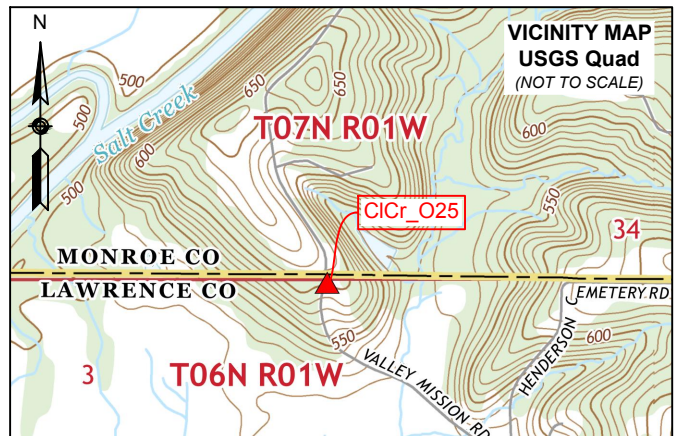

Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review Board
on March 20, 2018



Rachel Oser
Rachel Savich Oser, State of Indiana
Professional Surveyor No. 21100022

SHEET 3 OF 3	MONUMENT RECORD CORNER ID: C1Cr_O25	Quarter Corner Section 34 - T07N-R01W Clear Creek Township Monroe County, Indiana	 MONROE COUNTY SURVEYOR'S OFFICE Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	---	---	---